OMB Control No.: 2127-0004

Part 573 Safety Recall Report

23V-410

Manufacturer Name: Kia America, Inc.
Submission Date: JUN 07, 2023
NHTSA Recall No.: 23V-410



Manufacturer Information:

Manufacturer Name: Kia America, Inc.

Manufacturer Recall No.: SC272

Address: 111 Peters Canyon Road

Irvine CA 92606

Company phone: 800-333-4542

Population:

Number of potentially involved: 98,944 Estimated percentage with defect: 1 %

Vehicle Information:

Vehicle 1: 2023-2023 Kia Sportage

Vehicle Type: LIGHT VEHICLES

Body Style: ALL Power Train: GAS

Descriptive Information: Certain 2023 model year Sportage vehicles manufactured at the Kia Georgia plant

from January 12, 2022 to February 15, 2023.

The recall population was determined by a review of vehicle production and supplier records. The vehicles subject to this recall were not produced in VIN order. Customers seeking information about their specific vehicle will be referred to Kia's Customer

Care Center or their Kia dealer.

Production Dates: JAN 12, 2022 - FEB 15, 2023

VIN Range 1 : Begin : NR End : NR Not sequential

Description of Defect:

Description of the Defect: The brake booster diaphragm may become misaligned resulting in an internal

vacuum leak. An internal vacuum leak can cause loss of brake assist. A loss of brake assist can result in hard pedal feel and increased effort during pedal

application thereby increasing stopping distances.

FMVSS 1: NR FMVSS 2: NR

Description of the Safety Risk: A loss of brake assist increases the risk of a crash.

Description of the Cause: Internal vacuum leak due to a misaligned brake booster diaphragm.

Identification of Any Warning None.

that can Occur:

Involved Components:

Component Name 1: BOOSTER ASSY-BRAKE

Component Description: Brake Booster Assembly

Component Part Number: 59110-CW200

Supplier Identification:

Component Manufacturer

Name: Mobis Mexico

Address: Los Ramones Kms.

13-15 Localidad La Arena Pesquería Foreign States 66679

Country: Mexico

Chronology:

See attached document titled "2023MY Sportage Brake Booster Chronology".

Description of Remedy:

Description of Remedy Program: All owners of the subject vehicles will be notified by first class mail with

instructions to bring their vehicles to a Kia dealer. Kia will instruct dealers to inspect the brake booster and if necessary, replace it with a new one. Kia will reimburse owners for repair expenses already incurred pursuant

to Kia's General Reimbursement Plan filed May 10, 2022.

How Remedy Component Differs The brake booster diaphragm is properly aligned.

from Recalled Component:

Identify How/When Recall Condition Kia Georgia implemented an inspection procedure to confirm proper

was Corrected in Production: brake booster diaphragm alignment. This inspection procedure was

applied to vehicles produced beginning on 2/16/2023.

Recall Schedule:

Description of Recall Schedule: The planned dealer notification begin and end date is June 12, 2023. The

planned owner notification begin and end date is July 21, 2023.

Planned Dealer Notification Date: JUN 12, 2023 - JUN 12, 2023

Planned Owner Notification Date: JUL 21, 2023 - JUL 21, 2023

Part 573 Safety Recall Report	23V-410	Page 3
* NR - Not Reported		
The information contained in this report was submitt	ted pursuant to 49 CFR §573	