Part 573 Safety Recall Report

Manufacturer Name :Chrysler (FCA US, LLC)Submission Date :SEP 07, 2023NHTSA Recall No. :23V-623Manufacturer Recall No. :98A

Manufacturer Information :

Manufacturer Name : Chrysler (FCA US, LLC) Address : 800 Chrysler Drive CIMS 482-00-91 Auburn Hills MI 48326-2757 Company phone : 1-800-853-1403

Vehicle Information :

Vahiala 1.	2023-2024 Alfa Romeo Tonale		
	2023-2024 Alla Romeo Tonale		
Vehicle Type :			
Body Style :			
Power Train :	NR		
Descriptive Information :	Some 2023-2024 MY Alfa Romeo Tonale Plug-In Hybrid Electric Vehicles ("PHEVs") may have been built with missing or an incorrectly torqued nut on the 12 Volt ("12V") battery positive cable on the integrated dual charging module ("IDCM"), as well as the two high voltage ("HV") connections with grounds.		
	The suspect period began on February 9, 2023, when loose 12V battery positive cable nuts and/or high voltage connectors were introduced into vehicle production, and ended on August 23, 2023, when Stellantis Europe S.p.A. began containing vehicles under its control. Vehicle production records were used to determine the suspect period.		
	period, or were built with a pro connections on the IDCM.	this recall were built before or aft perly torqued 12V battery and hig	-
	The total affected vehicles for the	his model is 1,875.	
Production Dates :	FEB 09, 2023 - AUG 23, 2023		
	Begin : NR	End: NR	Not sequential

Population :

Number of potentially involved : 4,129Estimated percentage with defect : 1%



23V-623

The information contained in this report was submitted pursuant to 49 CFR §573

Part 573 Safety Recall Report

23V-623

Vehicle 2:	2023-2024 Dodge Hornet	
Vehicle Type :		
Body Style :		
Power Train : Descriptive Information :	Some 2023-2024 MY Dodge Hornet PHEVs may have been built with missing or an incorrectly torqued nut on the 12V battery positive cable on the IDCM, as well as the two HV connections with grounds.	
	The suspect period began on December 13, 2022, when loose 12V battery positive cable nuts and/or high voltage connectors were introduced into vehicle production and ended on August 23, 2023, when Stellantis Europe S.p.A. began containing vehicles under its control. Vehicle production records were used to determine the suspect period.	
	Similar vehicles not included in this recall were built before or after the suspect period, or were built with a properly torqued 12V battery and high voltage connections on the IDCM.	
	The total affected vehicles for this model is 2,254.	
	•	
	· DEC 13, 2022 - AUG 23, 2023 Begin : NR End : NR	
Production Dates : VIN Range 1 :		
VIN Range 1:		
VIN Range 1:		
VIN Range 1 : Description of Defect :		
VIN Range 1 : Description of Defect : Description of the Defe FMVSS	Begin : NR End : NR Image: Not sequential ct : A loose 12V battery positive cable and/or high voltage connectors may result in a high resistance in the connection to the IDCM which may lead to a vehicle	
VIN Range 1 : Description of Defect : Description of the Defe FMVSS FMVSS	Begin: NR End: NR In Not sequential ct: A loose 12V battery positive cable and/or high voltage connectors may result in a high resistance in the connection to the IDCM which may lead to a vehicle fire with the ignition on or off. f1: NR	
VIN Range 1 : Description of Defect : Description of the Defe FMVSS FMVSS	Begin : NR End : NR Not sequential ct : A loose 12V battery positive cable and/or high voltage connectors may result in a high resistance in the connection to the IDCM which may lead to a vehicle fire with the ignition on or off. 1 : NR 2 : NR sk : A vehicle fire can result in increased risk of occupant injury and/or injury to persons outside the vehicle, as well as property damage.	
VIN Range 1 : Description of Defect : Description of the Defe FMVSS FMVSS Description of the Safety Ri	Begin: NR End: NR Image: Not sequential in the sequential in a high resistance in the connection to the IDCM which may lead to a vehicle fire with the ignition on or off. 1: NR 2: NR sk: A vehicle fire can result in increased risk of occupant injury and/or injury to persons outside the vehicle, as well as property damage. se: NR ing None	

The information contained in this report was submitted pursuant to 49 CFR \$573

Part 573 Safety Recall Report

Component Name 1:	Nut
Component Description :	Positive Cable Nut
Component Part Number :	14076515
Component Name 2 :	Screw
Component Description :	Ground Cable Screws
Component Part Number :	18752121
Component Name 3 :	Connector
Component Description :	High Voltage Connector Cable with screw
Component Part Number :	50574018

Supplier Identification :

Component Manufacturer

Name : DA-TOR S.P.A. A SOCIO UNICO Address : VIA PROVINCIALE N.2 - VERDERIO (LC) N/A Foreign States 23879 Country : Italy

Chronology:

• On August 23, 2023, the Stellantis Europe S.p.A. Customer Experience ("CX") organization opened an investigation as a result of an assembly plant report checking presence and torque of the IDCM positive battery cable nut.

• From August 23, 2023, through August 29, 2023, Stellantis Europe S.p.A. CX reviewed production data, met with engineering to understand the design and history, and reviewed torque traceability data.

• On August 24, 2023, the Pomigliano plant issued a corrective action by updating the wireless screwdriver and adding results tracking to their manufacturing execution system.

• As of August 30, 2023, Stellantis Europe S.p.A. is aware of zero customer assistance records, zero warranty claims, and two field reports potentially relating to this issue for all markets with dates of receipt ranging from July 18, 2023, through August 14, 2023.

The information contained in this report was submitted pursuant to 49 CFR §573

• As of August 30, 2023, Stellantis Europe S.p.A. is not aware of any accidents or injuries potentially relating to this issue for all markets.

• On August 30, 2023, Stellantis Europe S.p.A. determined, through the Vehicle Regulations Committee, to conduct a voluntary safety recall of the affected vehicles.

Description of Remedy :

Description of Remedy Program :	FCA US LLC ("FCA US") will conduct a voluntary safety recall to check presence and torque of the 12V IDCM battery positive cable nut and the HV connections and if necessary, install and/or properly torque the nuts and connections. Customers are advised to not park these vehicles inside of buildings or structures, or near other vehicles until the vehicle has the final repair completed.
	FCA US has a longstanding policy and practice of reimbursing owners who have incurred the cost of repairing a problem that subsequently becomes the subject of a field action. To ensure consistency, FCA US, as part of the owner letter, will request that customers send the original receipt and/or other adequate proof of payment to the company for confirmation of the expense.
5 1	This recall is not related to a part defect but rather an assembly issue where the vehicle may have been built with loose 12V battery positive cable and/or high voltage connectors. The remedy will be to inspect and replace or torque the nuts and connections.
Identify How/When Recall Condition was Corrected in Production :	NR
Recall Schedule :	
Description of Recall Schedule :	**09/07/2023: FCA US will notify dealers and begin notifying owners on or about $10/27/2023$.
Planned Dealer Notification Date :	OCT 27, 2023 - OCT 27, 2023
Planned Owner Notification Date :	

* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR §573