OMB Control No.: 2127-0004

Part 573 Safety Recall Report

23V-195

Manufacturer Name: Honda (American Honda Motor Co.)

Submission Date: MAR 23, 2023 NHTSA Recall No.: 23V-195 Manufacturer Recall No.: KP1



Manufacturer Information:

Manufacturer Name: Honda (American Honda Motor Co.)

Address: 1919 Torrance Blvd.

Torrance CA 90501

Company phone: 1-888-234-2138

Population:

Number of potentially involved: 15,848 Estimated percentage with defect: 1 %

Vehicle Information:

Vehicle 1: 2022-2022 Honda NVA110B

Vehicle Type: MOTORCYCLES

Body Style:

Power Train: GAS

Descriptive Information: The recall population was determined based on manufacturing records. The

production range reflects all possible vehicles that could experience the problem.

Production Dates: NOV 12, 2021 - DEC 15, 2022

VIN Range 1 : Begin : NR End : NR Not sequential

Description of Defect:

Description of the Defect: The speedometer cable was incorrectly routed on the vehicles, resulting in an

insufficient fit with the pinion gear and causing a gap in the speedometer's cover. The incorrect routing can result in the cable either breaking by the

speedometer side or detaching by the brake panel side.

FMVSS 1: NR FMVSS 2: NR

Description of the Safety Risk: If the speedometer cable breaks or detaches, the speedometer is rendered

inoperable, increasing the risk of a crash or injury.

Description of the Cause: The speedometer cable was routed incorrectly on the vehicle, causing the cable

to either break or detach.

Identification of Any Warning NR

that can Occur:

Involved	Components	:

Component Name 1: CABLE COMP, SPDMT

Component Description: Speedometer Cable

Component Part Number: 44830-KTE-9124

Supplier Identification:

Component Manufacturer

Name: NR

Address: NR

NR

Country: NR

Chronology:

February 2022

Honda received its first report of a speedometer cable detaching and launched an investigation.

March 2022

Honda received additional reports of speedometer cables detaching and received its first report of a speedometer cable breaking.

July 2022

Honda received additional reports of speedometer cables breaking and launched another investigation.

August 2022

Honda reproduced the cable detachment during testing.

December 2022

Honda reproduced the cable breakage during testing.

February 28, 2023

Honda identified the mechanism for the cable breakage and detachment issues.

March 16, 2023

Honda determined that a defect related to motor vehicle safety existed and decided to conduct a safety recall. As of March 16, 2023, Honda has received 38 warranty claims related to the issue between February 16, 2022 and March 16, 2023 with no reports of injuries or deaths related to this issue.

Description of Remedy:

Description of Remedy Program : Registered owners of all affected vehicles will be contacted by mail and

asked to take their vehicle to an authorized Honda Powersports dealer. The dealer will replace the speedometer cable with appropriate cable

routing.

Owners who have paid to have these repairs completed at their own expense will be eligible for reimbursement, in accord with the recall

reimbursement plan on file with NHTSA.

How Remedy Component Differs While the replacement speedometer cable remains the same, the cable will

from Recalled Component: be correctly routed.

Identify How/When Recall Condition The recall condition was corrected by properly installing the cable.

was Corrected in Production:

Recall Schedule:

Description of Recall Schedule: Dealer notification is scheduled to begin and end on or about

03/17/2023. Owner notification is scheduled to begin and end on or

about 05/1/2023.

Planned Dealer Notification Date: NR - NR

Planned Owner Notification Date: MAY 01, 2023 - MAY 01, 2023

^{*} NR - Not Reported