Part 573 Safety Recall Report

Manufacturer Name : Chrysler (FCA US, LLC) Submission Date : MAR 24, 2022 NHTSA Recall No.: 22V-180 Manufacturer Recall No.: Z24

Manufacturer Information :

Manufacturer Name : Chrysler (FCA US, LLC) Address: 800 Chrysler Drive CIMS 482-00-91 Auburn Hills MI 48326-2757 Company phone: 1-800-853-1403

Vehicle Information :

Vehicle 1: 2	021-2022 Jeep Grand Cherokee L	
Vehicle Type :		
Body Style : S	JV	
Power Train : N	R	
m	ome 2021-2022 MY Jeep Grand Cherokee L vehicles may have been built with a issing weld or welds from the seat back frame to the child tether on one or both of ne second row seats.	
w w tr Si p	he suspect period began on October 13, 2021, when the first vehicle was produced ith a missing weld or welds, and ended on February 2, 2022, when sort procedures ere implemented in vehicle production. Supplier and vehicle production and aceability records were used to identify the suspect period and specific vehicles. milar vehicles not included in this recall were built before or after the suspect eriod, have completed welds on the seat back frame, or were repaired prior to elease from the production plant.	
	CT 13, 2021 - FEB 02, 2022	
VIN Range 1: Be		
Vity Range 1. De		
Description of Noncompliance :		
	Federal Motor Vehicle Safety Standard ("FMVSS") 225 S6.3.1 requires that, "Strength requirements for tether anchorages [] when tested [] in accordance with S8 [] must not separate completely from the vehicle seat or seat anchorage or the structure of the vehicle." Vehicles built with a missing weld from the seat back frame to the child tether may not meet the FMVSS 225 strength requirement for tether anchorages.	
FMVSS 1	225 - Child restraint anchorage systems	
The information contained in this report was submitted pursuant to 49 CFR §573		



22V-180

Population :



Number of potentially involved : 4,586 Estimated percentage with defect : 3%

Part 573 Safet	y Recall Report
----------------	-----------------

FMVSS 2 : Description of the Safety Risk : Description of the Cause :	A tether anchorage separating completely from the vehicle seat may increase the risk of injury to the occupant of the child seat in a crash.	
Identification of Any Warning that can Occur :		
Involved Components :		
Component Name 1 : 1	Frame, Rear Seat Back	
•	Frame, Rear Seat Back 40% (RH)	
Component Part Number : 6	38545266AA	
Component Name 2 : 1	Frame, Rear Seat Back	
-	Frame, Rear Seat Back 60% (LH)	
Component Part Number : 6		
_		
Component Name 3 : 1	Frame, Rear Seat Back	
-	Frame, Rear Seat Back 40% (LH)	
Component Part Number : 6		
Supplier Identification :		

Component Manufacturer

Name : Magna International Address : 337 Magna Drive Aurora Foreign States L4G 7K1 Country : Canada

Chronology :

• On March 2, 2022, the FCA US LLC ("FCA US") Technical Safety and Regulatory Compliance organization recognized a vehicle build issue existed on certain vehicles related to the child restraint upper tether

The information contained in this report was submitted pursuant to 49 CFR §573

Page 2

22V-180

Part 573 Safety Recall Report

anchorage system on second row seats, potentially not in compliance with FMVSS 225.

• On March 17, 2022, FCA US determined, through the Vehicle Regulations Committee, to conduct a voluntary safety recall of the affected vehicles.

Description of Remedy :

Description of Remedy Program :	FCA US will conduct a voluntary safety recall on all affected vehicles to inspect and, if necessary, replace the second row seat back frame.
	FCA US has a longstanding policy and practice of reimbursing owners who have incurred the cost of repairing a problem that subsequently becomes the subject of a field action. To ensure consistency, FCA US, as part of the owner letter, will request that customers send the original receipt and/or other adequate proof of payment to the company for confirmation of the expense.
ů I	The remedy component will be a second row seat back frame properly welded to the child tether.
Identify How/When Recall Condition was Corrected in Production :	

Recall Schedule :

Description of Recall Schedule :	**03/24/2022: FCA US will notify dealers and begin notifying owners on
	or about 05/13/2022.
Planned Dealer Notification Date :	MAY 13, 2022 - MAY 13, 2022
Planned Owner Notification Date :	MAY 13, 2022 - MAY 13, 2022

* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR §573