

# Part 573 Safety Recall Report

# 23V-222

**Manufacturer Name :** Jaguar Land Rover North America, LLC**Submission Date :** MAR 30, 2023**NHTSA Recall No. :** 23V-222**Manufacturer Recall No. :** N780**Manufacturer Information :****Manufacturer Name :** Jaguar Land Rover North America, LLC**Address :** 100 Jaguar Land Rover Way

Mahwah NJ 07495

**Company phone :** 8188500**Population :****Number of potentially involved :** 1**Estimated percentage with defect :** 100 %**Vehicle Information :****Vehicle 1 :** 2023-2023 LAND ROVER RANGE ROVER**Vehicle Type :** LIGHT VEHICLES**Body Style :** SUV**Power Train :** GAS

**Descriptive Information :** Jaguar Land Rover is conducting a voluntary safety recall campaign involving one 2023MY Land Rover Range Rover vehicle built at the Solihull Vehicle Assembly Plant on November 9, 2022. 1 vehicle in the United States and Federalized Territories. The basis for the recall population was established from engine build records from the engine supplier; affected engine has been traced to VINs through plant records.

**Production Dates :** NOV 09, 2022 - NOV 09, 2022**VIN Range 1 : Begin :** [REDACTED]**End :** [REDACTED] Not sequential**Description of Defect :**

**Description of the Defect :** A concern has been identified on one 4.4L V8-cylinder Gasoline Engine, fitted to a Land Rover Range Rover vehicle where a gasket has been miss-fitted or is missing from the turbo oil drain pipe.

**FMVSS 1 :** NR**FMVSS 2 :** NR

**Description of the Safety Risk :** A miss-fitted or missing gasket from a turbo oil drain pipe may result in an oil leak. Leaked oil can come into contact with the exhaust manifold, which may lead to a fire in the engine bay.

**Description of the Cause :** NR

**Identification of Any Warning that can Occur :** NR

## Involved Components :

Component Name 1 : Turbo oil drain gasket

Component Description : Turbo oil drain gasket

Component Part Number : M8P3-6N652-AA

## Supplier Identification :

### Component Manufacturer

Name : BMW

Address : Am Olympiapark 2  
Munich Foreign States 80809

Country : Germany

## Chronology :

On February 16, 2023, and February 21, 2023, Jaguar Land Rover (JLR) received reports from the supplier of the V8-cylinder gasoline engine, that three engines manufactured were suspected to have a turbo oil drain pipe gasket miss-fitted or missing, these engines were inspected and repaired whilst in JLR's control.

On March 3, 2023, JLR received a further report from the supplier that two additional engines had been identified in this condition. These two engines were found to have been built into vehicles and these vehicles were identified to be outside of JLRs control. This issue was reported through JLRs critical concerns reporting process.

A Product Safety and Compliance Committee (PSCC) investigation was opened on March 10, 2023. The PSCC requested an Engineering team to fully define the scope of this issue. They reported their initial findings to the PSCC on March 14, 2023.

At the PSCC of March 21, 2023, the scope of the issue was discussed, the consequence of a miss-fitted or missing turbo oil drain pipe gasket was reviewed and it was agreed that the issue be progressed to the Recall Determination Committee (RDC) for consideration.

The RDC reviewed the issue on March 23, 2023, and concluded that this issue represents an unreasonable risk to safety, and a voluntary safety recall should be conducted to remedy the two vehicles identified (one in US).

There have been no reported accidents, injuries or fires as a result of this concern. There are no warranty claims or field reports related to this matter.

## Description of Remedy :

Description of Remedy Program : : A new turbo oil drain pipe gasket will be installed. There will be no charge to the owners for this repair.  
The affected vehicles will be covered under Jaguar Land Rover's new vehicle warranty program. Therefore, reimbursements for pre-notice remedies are not necessary because the affected vehicles are still under warranty.

How Remedy Component Differs from Recalled Component : NR

Identify How/When Recall Condition was Corrected in Production : NR

## Recall Schedule :

Description of Recall Schedule : Notifications to dealers will occur on April 13, 2023. Distribution of owner notification letters will occur on or before May 26, 2023.

Planned Dealer Notification Date : APR 13, 2023 - APR 13, 2023

Planned Owner Notification Date : MAY 26, 2023 - MAY 26, 2023

\* NR - Not Reported