Part 573 Safety Recall Report

Manufacturer Name :Triumph Motorcycles America, Ltd.Submission Date :JAN 16, 2023NHTSA Recall No. :23V-006Manufacturer Recall No. :SRAN 605



Number of potentially involved : 1,351 Estimated percentage with defect : 1 %

Population :

23V-006

Manufacturer Information :

Manufacturer Name :Triumph Motorcycles America, Ltd.Address :100 Hartsfield Centre ParkwaySuite 200 Atlanta GA 30354Company phone :678-854-2010

Vehicle Information :

Vehicle 1:	2022-2023 Triumph Speed Triple RS	
Vehicle Type :	MOTORCYCLES	
Body Style :	OTHER	
Power Train :	GAS	
Descriptive Information :	The recall population was based upon a review of factory records.	
Production Dates :	FEB 03, 2021 - DEC 22, 2022	
VIN Range 1 : Begin : SMTP01ST6NTAF7370 End : SMTP01ST8PTBJ3168 Over Not sequential		
Vehicle 2:	2022-2023 Triumph Speed Triple RR	
Vehicle Type :	MOTORCYCLES	
Body Style :	OTHER	
Power Train :	GAS	
Descriptive Information :	The recall population was based upon a review of factory records.	
Production Dates : SEP 02, 2021 - OCT 05, 2022		
VIN Range 1 : Begin : SMTP02ST1NTAW2194 End : SMTP02ST1PTBG4464 IN Not sequential		

Description of Defect :

Description of the Defect : FMVSS 1 : FMVSS 2 :	
	Hot engine coolant may be expelled. Under high ambient temperature and slow moving traffic situations, the maximum operating temperature of the radiator fan can be exceeded, leading to a malfunction of the fan motor. If the rider ignores the instrument warning light and continues to operate the motorcycle at low speed, coolant may be displaced.

The information contained in this report was submitted pursuant to 49 CFR §573

Part 573 Safety Recall Report

23V-006

Page 2

Identification of Any Warning Instrument warning light will illuminate. that can Occur :

Involved Components :

Component Name 1: NR

Component Description : NR

Component Part Number: NR

Supplier Identification :

Component Manufacturer

Name : NR Address : NR NR Country : NR

Chronology:

End of June22: The Triumph Warranty department observes an increase in Warranty claims received and commences an investigation.

Aug22: Triumph Quality department requests parts back from the field to verify in-service claims. Jan23: Triumph Recall Committee agree to launch a voluntary in-service campaign.

Description of Remedy :

Description of Remedy Program :	Triumph will install an additional heatshield to affected motorcycles which will deflect the heat away from the radiator fan.
	Defective motorcycles will not have the heat shield fitted. Remedied motorcycles will have the heatshield fitted.
5	Affected models will be fitted with the additional heatshield once production of these models recommences at the end of January 2023.

The information contained in this report was submitted pursuant to 49 CFR §573

Recall Schedule :

Description of Recall Schedule : The planned notification dates are an estimate and may be revised.

Planned Dealer Notification Date :JAN 30, 2023 - JAN 30, 2023Planned Owner Notification Date :FEB 01, 2023 - FEB 01, 2023

* NR - Not Reported

The information contained in this report was submitted pursuant to 49 CFR §573